

Date: Tuesday, 22/07/2008 11:24:32 AM
 User: Julie Lécocq

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : 350 SKIDTUBE ASSEMBLY RH
Job Number : 40699	
Estimate Number : 10265	
P.O. Number :	Part Number : D350636012
This Issue : 22/07/2008 S.O. No. :	Drawing Number : D2750 UNDER REVIEW — UPDATE PER DSI 9413 Ret 03-07-22
Prsht Rev. : NC	Project Number : N/A
First Issue : / / Type : SKIDTUBES	Drawing Revision :
Previous Run : 39764	Material :
Written By :	Due Date : 10/08/2008 Qty: 1 Um: Each
Checked & Approved By : <u>JLD 08.7.22</u>	
Comment :	
Est Rev:I 02.09.25 Rearranged procedure steps KJ	
Est Rev:J 06-03-29 As per Rev D EC	
Est Rev:K 06-07.13 As per dsi9343 EC	
Est Rev:L 07-07-28 Added SS Wearplates(Rev E) JLM	
Verified By:EC	
Est Rev:M 08-04-22 update steps 4,13 DD verified by:EC	

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------

**Comment:** DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-012 CHG 004 + DSI 9413 Ret 03-07-22

2.0	D26003BENT	Extrusion Bent
-----	------------	----------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2600-3-Bent	Extrusion (Bent)	B39714

M 8-7-29 (1)

3.0	D2744	Cap
-----	-------	-----

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: B37768 M 8-7-29 (1)

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------

**Comment:** LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details).Drill using drill Jig DT8150 & DT8863.

M 8-7-29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 22/07/2008 11:24:32 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 40699

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8863 and cut as per dwg D2750.

4-Drill pilot holes for Detail G using DT8329

5-Open up holes for Detail B to 0.375" (4 holes per side) blade fitting location holes to 0.500" (total of 5 holes per side) as per dwg D2750. Open holes for ground handling and detail E to 0.500" (8 holes per side)

6-Drill pilot holes for wearplates as per Dwg D2750 using DT8108

****Make sure that wearplate holes are on bottom of tube*****

Open 4 aft wearplate holes to 0.250". Open remaining wearplate holes to 0.297".

7-Open up holes of Detail A to 0.297" (total of 2 holes per side)

9-Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004

A/R Aluminum Rod *m108096/m107877 BE 08/07-29*

10-Grind welds flush as per Dwg D2750

BE 08/07/29

5.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 08/07/29 (40)

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/07/29 (40)

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

M 8-7-29

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

S 8/7/29

9.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

X Web
Batch: *40723* *SL87-29*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 22/07/2008 11:24:32 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 40699

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

10.0

D34901

Cross Bolt Spacer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch: *239584*

BE 08/07/31

11.0

D34903

Cross Bolt Spacer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch: *840727*

BE 08/07/31

12.0

D2743

Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Crossbolt Spacer

Batch: *838755*

BE 08/07/31

13.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open up holes of Detail E and ground handling to 0.625" (total of 8 holes per side)
as per dwg D2750.

2-Open up holes of Detail B to 0.750" (total of 4 holes per side)
as per dwg D2750.

3-Open float holes to .500" (4 per Side)

4-Chamfer holes of Detail B, E, ground handling and float holes per dwg D2750 (welding instructions on
sheet 4)

5-Deburr and blow out all chips from inside of tube

6-Prepare tube for welding, remove alodine as required.

7-Bond web D2739 in place as per QSI 015

A/R

Sikaflex-291

batch: *107888*

exp. date: *5-11-1*

SL 8-7-29

8- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004
(welding instructions on sheet 4)

BE 08/07/29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 22/07/2008 11:24:32 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 40699

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

A/R Aluminum Rod batch: M108096 BE 08/07/31

9-Grind welds flush as per Dwg D2750

10-Spot face ground handling holes section P-P (total of 4 places per side) as per dwg D2750

11-Deburr holes

AWM
8-8

14.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 8/8/6 (40)

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 8/8/6 (40)

16.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

M-1 08/08/06

(1X)

17.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

7:45
320 °F
8:15

M-1 08/08/07

(1X)

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

08-08-07 (X1)

19.0

ALS41032225

Insert



Comment: Qty: 334 0000 Each(s)/Unit Total: 42 0000 Each(s)

Insert

Batch: M100489

91 08-08-07 (4)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 22/07/2008 11:24:32 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 40699

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1
1-Install inserts as per dwg D2750

98 08-08-07 (X1)

21.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

Bushing

Batch: B36320

98

22.0

D353525

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch: B39716

98

23.0

D353625

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B40729

98

24.0

D35371

Wearpad



Comment: Qty.: 3.0000 Each(s)/Unit Total: 3.0000 Each(s)

WEARPAD

Batch: B38941

98

25.0

D37911

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Wearplate B39692

98

26.0

D37931

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Wearshoe B39715

98

08-08-07 (X1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 22/07/2008 11:24:32 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 40699

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

27.0	D37933	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Wearshoe B40552 X 918

28.0	D37941	Gasket
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Gasket B40553 918

29.0	D37943	Gasket
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Gasket B39422 918

30.0	D36721	Phenolic Washer
------	--------	-----------------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)
Phenolic Washer M 39275 918

31.0	AN526C1032R10	Screw
------	---------------	-------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)
Screw M 108062 918

32.0	AN526C1032R18	Screw
------	---------------	-------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)
Screw M 108079 918

33.0	D36311	Washer
------	--------	--------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)
WASHER
Batch: B38139 918

34.0	D3488042	Blade Fitting Assembly, RH
------	----------	----------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Blade Fitting, RH
Batch: B38466 918

08.08.07 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 22/07/2008 11:24:33 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 40699

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

D3492041

Plug Assembly



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

PLUG ASSEMBLY

Batch: ~~(4x)~~ = 1339725(4x) 1341058 X

YH

36.0

D3492043

Plug Assembly



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

PLUG ASSEMBLY

Batch: 340728

YH

37.0

AN3C5A

Bolt



Comment: Qty.: 34.0000 Each(s)/Unit Total: 34.0000 Each(s)

Bolt

Batch: (30x) = 7 M108302 (8x) = 7 M108744

YH

38.0

AN3C6A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Bolt

Batch: M1105300

YH

39.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

BOLT

Batch: M1108284

YH

40.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

BOLT

Batch: M1106896

YH

41.0

AN960C10L

washer



Comment: Qty.: 38.0000 Each(s)/Unit Total: 38.0000 Each(s)

washer

Batch: M1108672

YH

02-08-07 (K0)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 22/07/2008 11:24:33 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 40699

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

42.0

AN960C816L

WASHER



1 per 03.07.22



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

WASHER

Batch: M1107520

JS

43.0

MS210436

NUT



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

NUT

Batch: M1108740

JS

44.0

MS21083C8

NUT



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

NUT

Batch: M1108744

JS

45.0

NAS1515H3L

WASHER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

WASHER

Batch: M1107394

JS

46.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

WASHER

Batch:

NOT REQ'D

M

PER DSI 9413

03.07.22

47.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

✓ 1-Inspect for Foreign Objects

2-Spray inside of tube with "LPS-3"

✓ batch: M1107912

3-Install blade fitting D3488-042, wearshoes and ground handling hardware as per dwg D2750

SIKA FLEX 241

✓ BATCH: M1108801

EXP DATE: 08/10

JS

02-08-22

21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 22/07/2008 11:24:33 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 40699

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Coat all exposed fasteners with "LPS Procyon"

batch: M104251

HL

08-08-08

K1

48.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/08/13 (4)

49.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

CHG 004

PH

03.07.22

50.0

D2741

Blade, 350 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Blade

Batch: B338558

SC

51.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M107520

SC

52.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Nut

Batch: M108744

SC

53.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: M107924

SC

54.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

WASHER

Batch: M107581

8/8/14

SC

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 22/07/2008 11:24:33 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 40699

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

55.0

D34931

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: B39985

SL

56.0

D35321

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

spacer

Batch: B38594

8/8/14

SP

57.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

2008.12.1

58.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-012

Rev G hoc 72

03.07.22

CHG 004

8/8/14

SP

59.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

2008.12.1

Job Completion



U 08.08.15

B340699

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART**RELEASED**
07-08-02

DESIGN <i>PH</i>	DRAWN BY <i>CB</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2750	REV. E SHEET 1 OF 5
DATE 07.05.17		TITLE 350 SKIDTUBE ASSEMBLY SCALE NTS	
REV	DATE	DESCRIPTION	
A	98.04.16	NEW ISSUE	
B	98.09.01	CHANGE MS24694-S293 TO AN8-16A	
C	98.11.18	ADD D2750-3 / D2750-4; INCORPORATE D2738 AND D2740	
D	06.01.05	ADD HOLES AND SPACERS FOR APICAL FLOATS INCORPORATE DEO 9133 / 9157	
E	07.05.17	CHANGE TO STAINLESS STEEL WEARPLATES; ADD RUBBER GASKETS; CHANGE INSERTS; ADD D3631-1; REMOVE QTY(38) NAS1515H3L; REMOVE QTY(10) NAS1515H8L; REMOVE D2741, QTY(2) AN960C816; REMOVE QTY(2) MS21083C8	

Qty -041	Qty -042	Qty -043	Qty -044	Part Number	Description
X				D2750-041	SKIDTUBE ASSEMBLY, LH
	X			D2750-042	SKIDTUBE ASSEMBLY, RH
		X		D2750-043	SKIDTUBE ASSEMBLY, LH
			X	D2750-044	SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
1	1	1	1	D3535-13	WEARSHOE
1	1	1	1	D3535-25	WEARSHOE
1	1	1	1	D3535-35	WEARSHOE
1	1	1	1	D3536-13	GASKET
1	1	1	1	D3536-25	GASKET
1	1	1	1	D3536-35	GASKET
5	5	5	5	D3537-1	WEARPAD
8	8	8	8	D3631-1	WASHER
42	42	42	42	ALS4-1032-225	INSERT (OR ALS7-1032-225, AKS4-1032-225, AELS-1032-225)
38	38	38	38	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN3C7A	BOLT
4	4	4	4	AN6C44A	BOLT
1	1	1	1	AN8C35A	BOLT
46	46	46	46	AN960C10L	WASHER
2	2	2	2	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER
2	2	2	2	NAS1515H8L	WASHER

PH 07.02.22
UNDER REVIEW
07.06.27
UPDATE
PER
DSI 9419

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. *400098*

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



DESIGN <i>PH</i>	DRAWN BY <i>CB</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2750	REV. E SHEET 2 OF 5
DATE 07.05.17		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS

GENERAL NOTES:

RELEASED
07.08.02 *[Signature]*

1. ALL DIMENSIONS ARE IN INCHES.
2. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
3. MAKE FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
4. DAMAGE TOLERANCE ON BENDING:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 12 INCHES ABOVE THE GROUND. NO GOUGING IS ACCEPTABLE IN THE FLAT PORTION OF THE TUBE. GOUGES UP TO 0.020 ARE ACCEPTABLE IN THE BENT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.150 ± 0.010 IN THE FLAT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.15 ± 0.030 IN THE BENT PORTION OF THE TUBE.
5. ALL HOLES DRILLED ON CENTERLINES EXCEPT THOSE NOTED BY SECTIONS C-C, D-D AND F-F.
6. WELDING TO BE DONE PER DART QSI 004.
7. FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 ksi
MINIMUM ULTIMATE TENSILE STRENGTH = 38 ksi
8. FINISH:
ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
9. INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED IN D2750-1/-2/-3/-4. WELDING DETAIL ON PAGE 4 AND 5. DRILL 'F' SIZE HOLES ($\emptyset 0.297$) FOR WEARSHOE INSERTS.
10. D3488-041 (OR D3488-042) BLADE FITTING AND AN3C5A/AN3C7A WEARSHOE BOLTS TO BE INSTALLED USING SIKAFLEX-241 (OR EQUIVALENT) SEALANT.
11. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.

SHOP COPY
RETURN TO
ENGINEERING

UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE
WORK ORDER

NO. 40698

pet
07.09.22
UNDER REVIEW
07.05.27 *[Signature]*
UPDATE
PER
DSI 9419

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DART SERVICE INSTRUCTION


TO AMEND INSTALLATION INSTRUCTIONS IIN-D350-636 REV E

REF FAA STC: SR00646SE

REF CANADIAN STC: SH99-7

THE WEARPLATES ON D350-636-011/-012/-013/-014 SKIDTUBES AT CHG 004 (AND LATER) HAVE BEEN MODIFIED AS SHOWN IN FIGURE 1 BELOW TO ELIMINATE THE POSSIBILITY OF INTERFERENCE BETWEEN THE WEARPLATES AND CROSSTUBE SADDLES AT INSTALLATION. THERE IS NEGLIGIBLE WEIGHT CHANGE ASSOCIATED WITH THIS MODIFICATION.

WAS

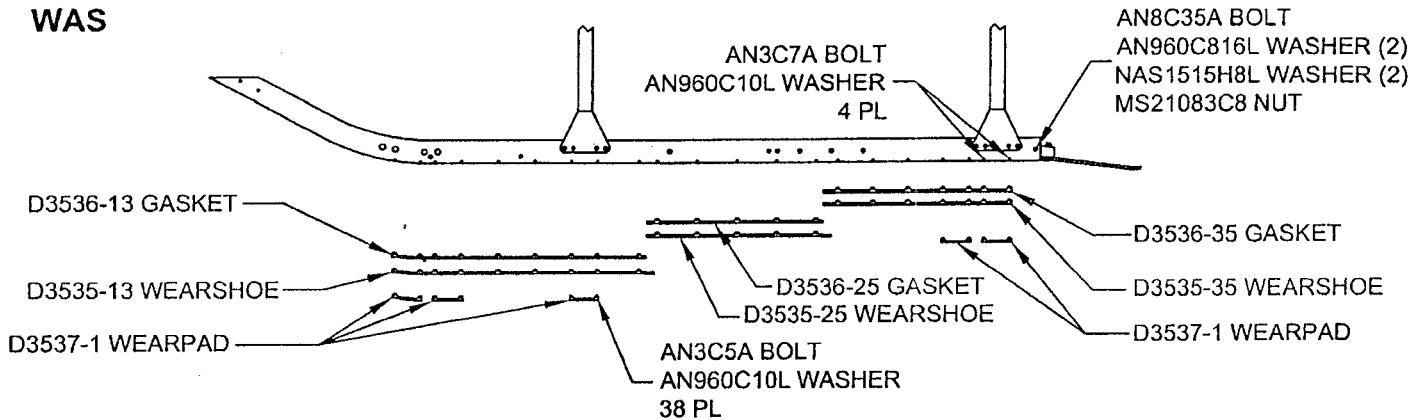

NOW

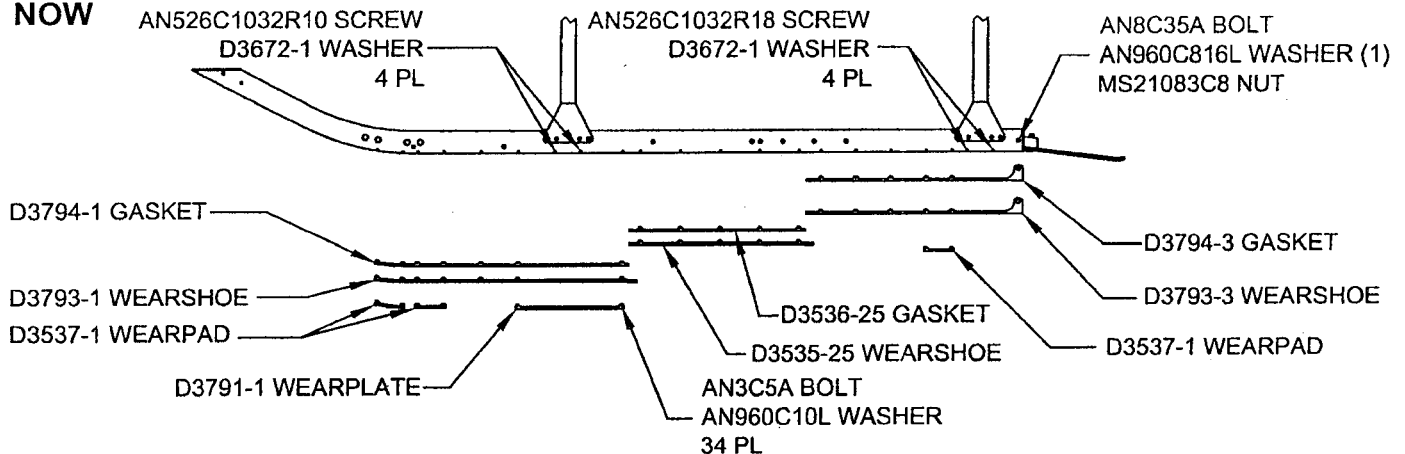


FIGURE 1 - WEARPLATE MODIFICATION

(AN526C1032RXX SCREW LOCATIONS NO LONGER USED TO MOUNT WEARSHOES)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 40599

A	NEW ISSUE	PH	08.05.14
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC PORT HADLOCK, WA	
DRAWN	PH		
CHECKED		DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9413	SHEET 1 OF 3
APPROVED		TITLE	SCALE
DE APPR.		WEARSHOE MODIFICATION	NTS
DATE	08.05.14	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

FOR D350-636-011/-012/-013/-014 SKIDTUBES AT CHG 004, AMEND PARTS LIST OF IIN-D350-636 SECTION 5 AS FOLLOWS:

REMOVE:

Item	Qty -011	Qty -012	Qty -013	Qty -014	Part Number	Description
	X				D350-636-011	SKIDTUBE INSTALLATION, LH, STD AERAZUR/APICAL CYLINDRICAL FLOAT COMPATIBLE
		X			D350-636-012	SKIDTUBE INSTALLATION, RH, STD AERAZUR/APICAL CYLINDRICAL FLOAT COMPATIBLE
			X		D350-636-013	SKIDTUBE INSTALLATION, LH AIRCRUISER/ APICAL TRI-BAG FLOAT COMPATIBLE
				X	D350-636-014	SKIDTUBE INSTALLATION, RH AIRCRUISER/ APICAL TRI-BAG FLOAT COMPATIBLE
*6A	1	1	1	1	AN960C816L	WASHER
6B	2	2	2	2	NAS1515H8L	WASHER
*22	2	2	2	2	D3537-1	WEARPAD
23A	1	1	1	1	D3535-13	WEARSHOE
23B	1	1	1	1	D3536-13	GASKET
25A	1	1	1	1	D3535-35	WEARSHOE
25B	1	1	1	1	D3536-35	GASKET
*26A	4	4	4	4	AN3C5A	BOLT
*26B	4	4	4	4	AN3C7A	BOLT
*27	8	8	8	8	AN960C10L	WASHER

*SUBTRACT FROM TOTAL QUANTITY OF PARTS INDICATED IN INSTALLATION INSTRUCTIONS IIN-D350-636

ADD:

Qty -011	Qty -012	Qty -013	Qty -014	Part Number	Description
X				D350-636-011	SKIDTUBE INSTALLATION, LH, STD AERAZUR/APICAL CYLINDRICAL FLOAT COMPATIBLE
	X			D350-636-012	SKIDTUBE INSTALLATION, RH, STD AERAZUR/APICAL CYLINDRICAL FLOAT COMPATIBLE
		X		D350-636-013	SKIDTUBE INSTALLATION, LH AIRCRUISER/ APICAL TRI-BAG FLOAT COMPATIBLE
			X	D350-636-014	SKIDTUBE INSTALLATION, RH AIRCRUISER/ APICAL TRI-BAG FLOAT COMPATIBLE
1	1	1	1	D3791-1	WEARPLATE
1	1	1	1	D3793-1	WEARSHOE
1	1	1	1	D3793-3	WEARSHOE
1	1	1	1	D3794-1	GASKET
1	1	1	1	D3794-3	GASKET
8	8	8	8	D3672-1	WASHER
4	4	4	4	AN526C1032R10	SCREW
4	4	4	4	AN526C1032R18	SCREW

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 40599

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED	B	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9413	SHEET 2 OF 3
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	WEARSHOE MODIFICATION	NTS
DATE	08.05.14	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

TO IMPROVE THE INSTALLATION OF D350-636-011/-012/-013/-014 SKIDTUBES EQUIPPED WITH STAINLESS WEARPLATES/WEARPADS AND GASKETS (CHG 003) ONTO THE CROSSTUBES, THE FOLLOWING DSI 9413-011 WEARSHOE KIT CAN BE PROCURED FROM DART:

Qty -011	Part Number	Description
X	DSI 9413-011	WEARSHOE MODIFICATION KIT
1	D3791-1	WEARPLATE
1	D3793-1	WEARSHOE
1	D3793-3	WEARSHOE
1	D3794-1	GASKET
1	D3794-3	GASKET
8	D3672-1	WASHER
4	AN526C1032R10	SCREW
4	AN526C1032R18	SCREW

TO INSTALL THE DSI 9413-011 KIT, REMOVE THE EXISTING WEARSHOES/GASKETS UNDER THE FWD/AFT SADDLES AND INSTALL NEW WEARSHOES/GASKETS AS SHOWN IN FIGURE 1. PLUG UNUSED HOLES WITH AN526C1032RXX SCREWS AND D3672-1 WASHERS. INSTALL SCREWS WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS 'B2' SEALANT AS SHOWN IN FIGURE 1. NOTE: SOME OF THE PREVIOUSLY INSTALLED HARDWARE IS NO LONGER REQUIRED.

THE FOLLOWING D350-636-045 REPLACEMENT WEARPLATE KIT WILL BE AVAILABLE FOR D350-636-011/-012/-013/-014 SKIDTUBES AT CHG 004 OR LATER:

Qty -011	Part Number	Description
X	D350-636-045	WEARSHOE KIT
3	D3537-1	WEARPAD
1	D3535-25	WEARSHOE
1	D3536-25	GASKET
1	D3791-1	WEARPLATE
1	D3793-1	WEARSHOE
1	D3793-3	WEARSHOE
1	D3794-1	GASKET
1	D3794-3	GASKET
34	AN3C5A	BOLT
34	AN960C10L	WASHER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 40599

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9413	SHEET 3 OF 3
APPROVED		TITLE	SCALE
DE APPR.		WEARSHOE MODIFICATION	NTS
DATE	08.05.14	<small>COPYRIGHT © 2008 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

NO. 165

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Berclay Elliot
Job number: 040696
Part number: D350 626 01
Description: 350 skid
Welding Process: Tig[☒] Mig[]
Base material: Aluminium
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual:
Penetration:

pass[☒] fail[]
pass[☒] fail[]

UNACCEPTABLE

Cracks:
Undercut:
Pin holes:
Overlap (cold lap)
Porosity (surface):
Coloration:

pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]

Qualifier Pat Duvell Date of Test Coupon 08-08-01
Welder Berclay Elliot Date of Test Coupon 08-08-01

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

33

Date: Tuesday, 22/07/2008 2:00:52 PM
 User: Julie Lecocq

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : 350 SKIDTUBE ASSEMBLY RH
Job Number : 40699	
Estimate Number : 10265	
P.O. Number :	Part Number : D350636012
This Issue : 22/07/2008 S.O. No. :	Drawing Number : D2750 UNDER REVIEW
Prsht Rev. : NC	Project Number : N/A
First Issue : 22/07/2008 Type : SKIDTUBES	Drawing Revision :
Previous Run : 39764	Material :
Written By :	Due Date : 10/08/2008 Qty: 1 Um: Each
Checked & Approved By :	
Comment :	
Est Rev:I 02.09.25 Rearranged procedure steps KJ	
Est Rev:J 06-03-29 As per Rev D EC	
Est Rev:K 06-07.13 As per dsi9343 EC	
Est Rev:L 07-07-28 Added SS Wearplates(Rev E) JLM	
Verified By:EC	
Est Rev:M 08-04-22 update steps 4,13 DD verified by:EC	

REFERENCE ONLY

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



JUD 08/8/17

**Comment:** DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-012 CHG 004

2.0	D26003BENT	Extrusion Bent
-----	------------	----------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2600-3-Bent Extrusion (Bent)

3.0	D2744	Cap
-----	-------	-----

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap


Batch: _____

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------

**Comment:** LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details).Drill using drill Jig DT8150 & DT8863 .

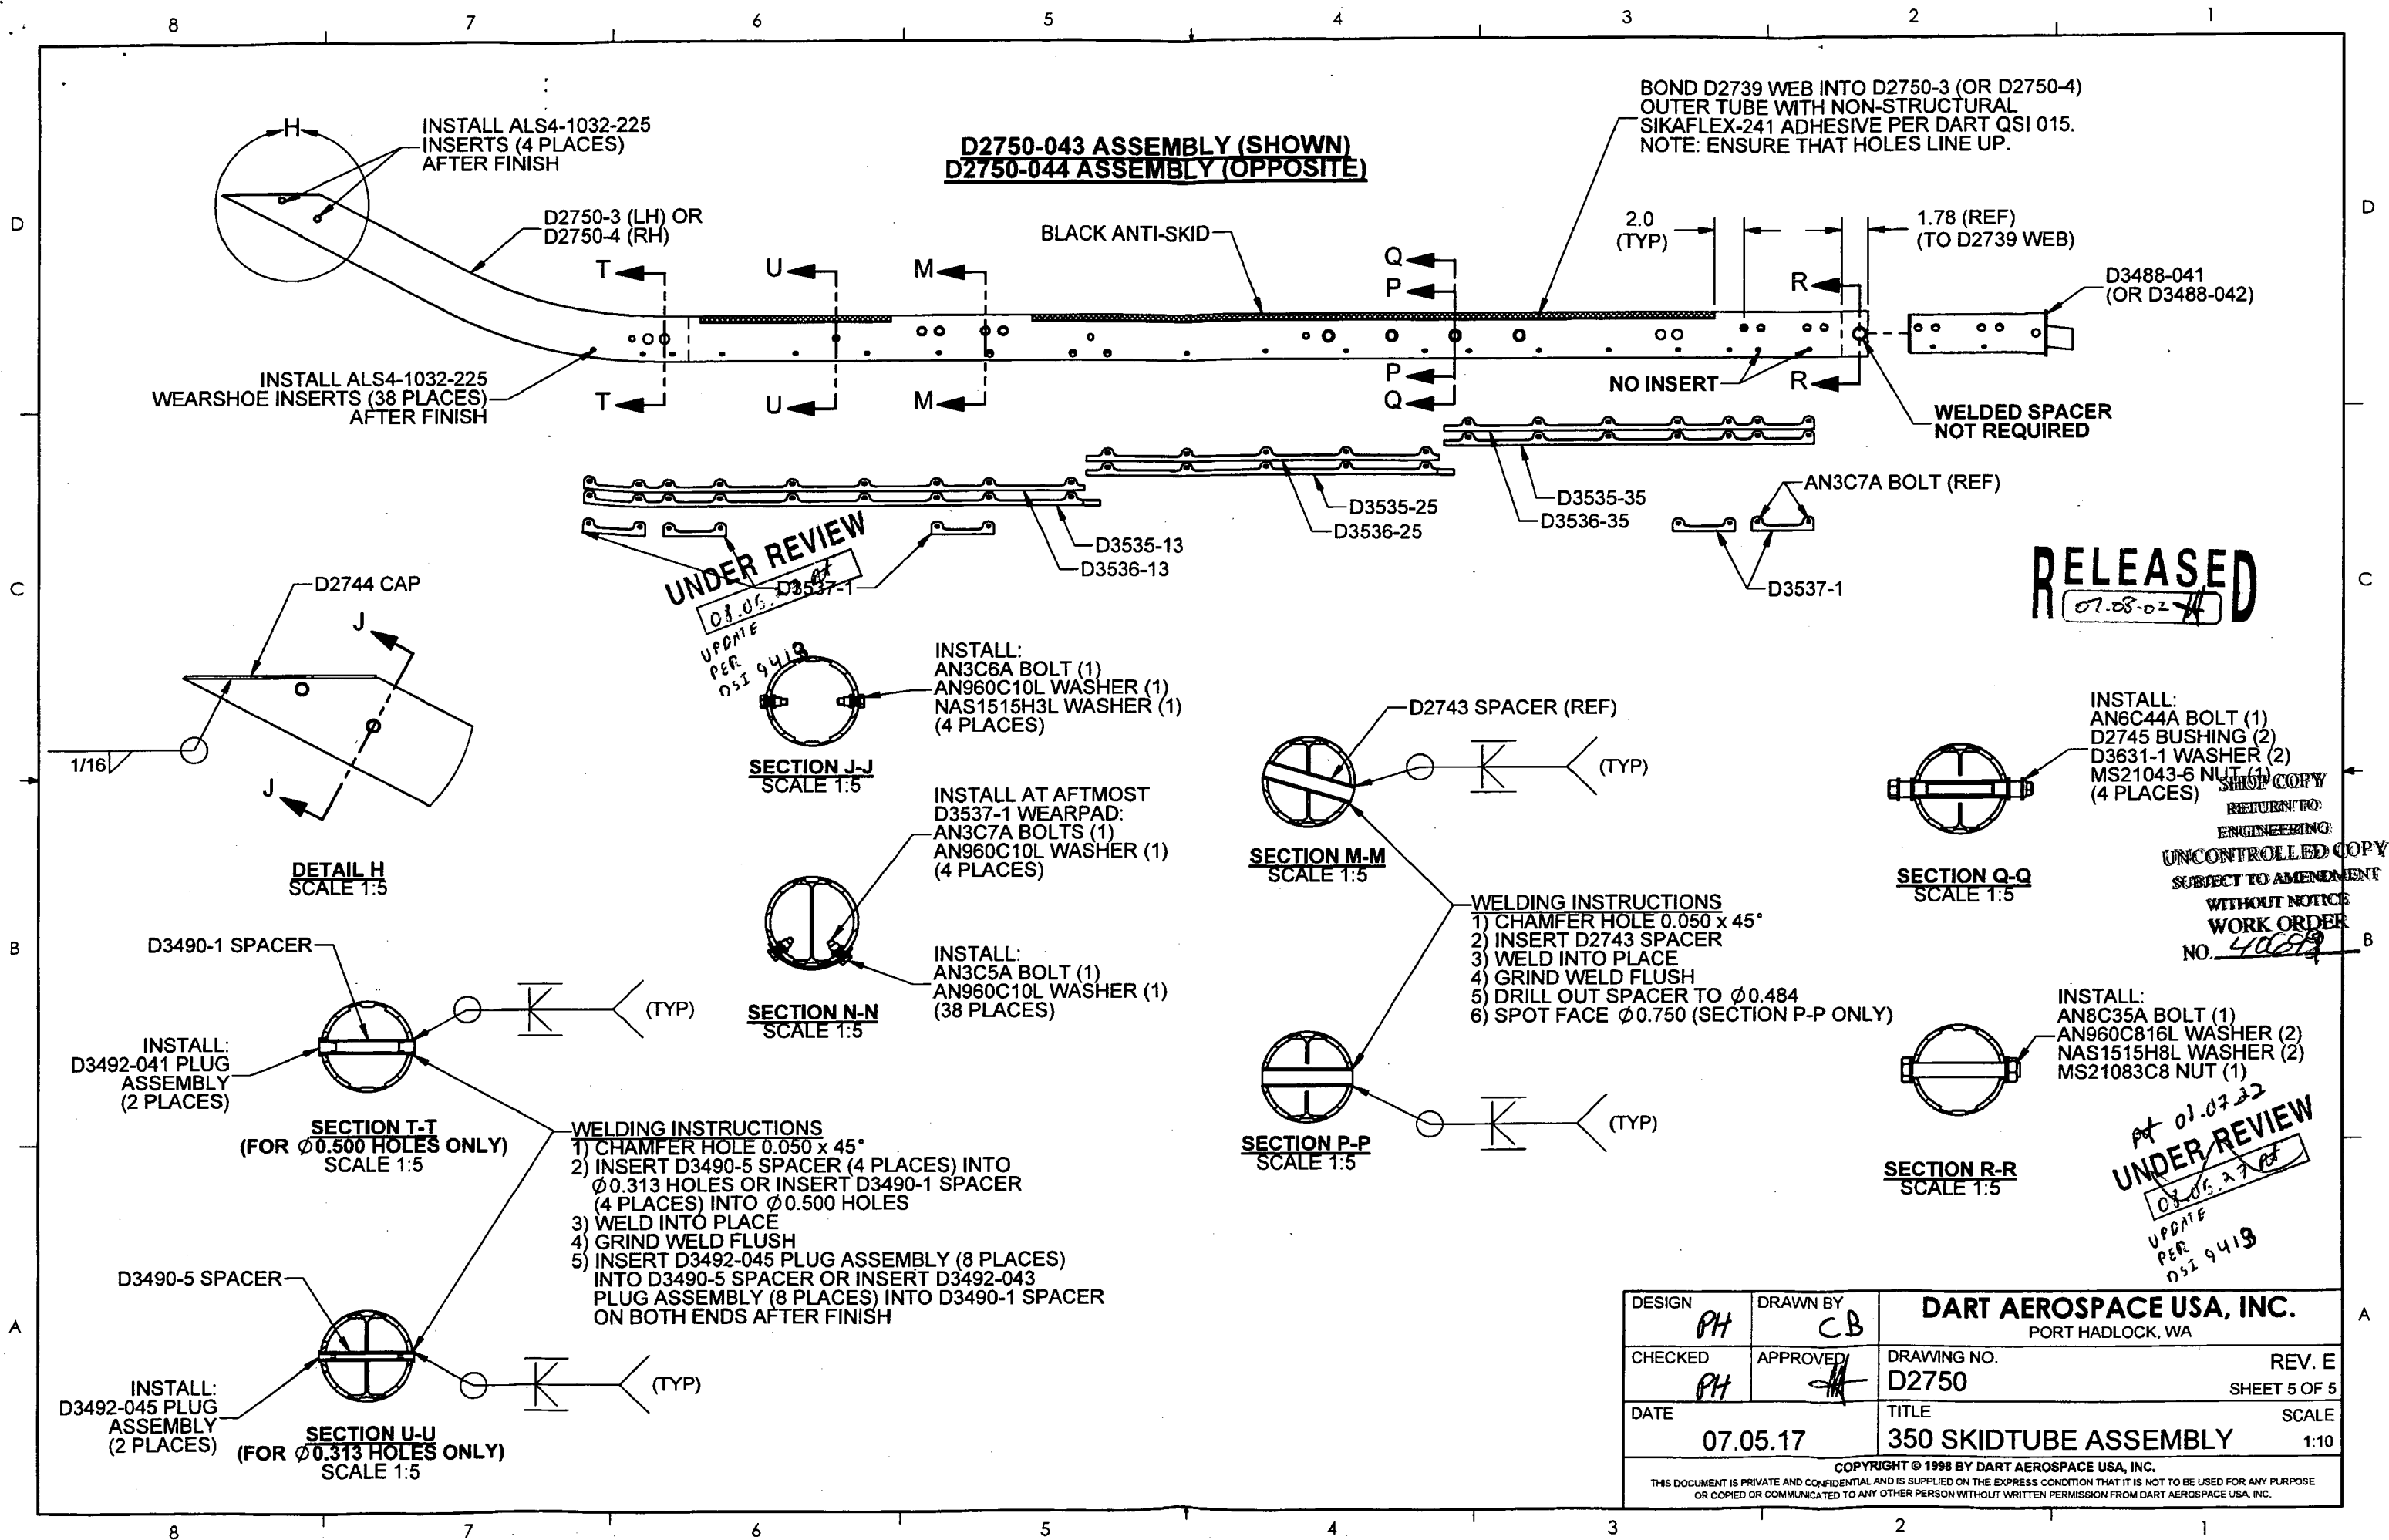

**D2750-043 ASSEMBLY (SHOWN)
D2750-044 ASSEMBLY (OPPOSITE)**

BOND D2739 WEB INTO D2750-3 (OR D2750-4)
OUTER TUBE WITH NON-STRUCTURAL
SIKAFLEX-241 ADHESIVE PER DART QSI 015.
NOTE: ENSURE THAT HOLES LINE UP.

RELEASED
07-08-02

INSTALL:
AN6C44A BOLT (1)
D2745 BUSHING (2)
D3631-1 WASHER (2)
MS21043-6 NUT (4)
(4 PLACES)
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 40289


INSTALL:
AN8C35A BOLT (1)
AN960C816L WASHER (2)
NAS1515H8L WASHER (2)
MS21083C8 NUT (1)

01.07.22
07.05.17
UNDER REVIEW
UPDATE
PER
DSI 9413


- WELDING INSTRUCTIONS**
- 1) CHAMFER HOLE 0.050 x 45°
 - 2) INSERT D2743 SPACER
 - 3) WELD INTO PLACE
 - 4) GRIND WELD FLUSH
 - 5) DRILL OUT SPACER TO Ø0.484
 - 6) SPOT FACE Ø0.750 (SECTION P-P ONLY)

- WELDING INSTRUCTIONS**
- 1) CHAMFER HOLE 0.050 x 45°
 - 2) INSERT D3490-5 SPACER (4 PLACES) INTO Ø0.313 HOLES OR INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES
 - 3) WELD INTO PLACE
 - 4) GRIND WELD FLUSH
 - 5) INSERT D3492-045 PLUG ASSEMBLY (8 PLACES) INTO D3490-5 SPACER OR INSERT D3492-043 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER ON BOTH ENDS AFTER FINISH




DESIGN PH	DRAWN BY CB	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED PH	APPROVED [Signature]	DRAWING NO. D2750	REV. E SHEET 5 OF 5
DATE 07.05.17		TITLE 350 SKIDTUBE ASSEMBLY	SCALE 1:10
COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

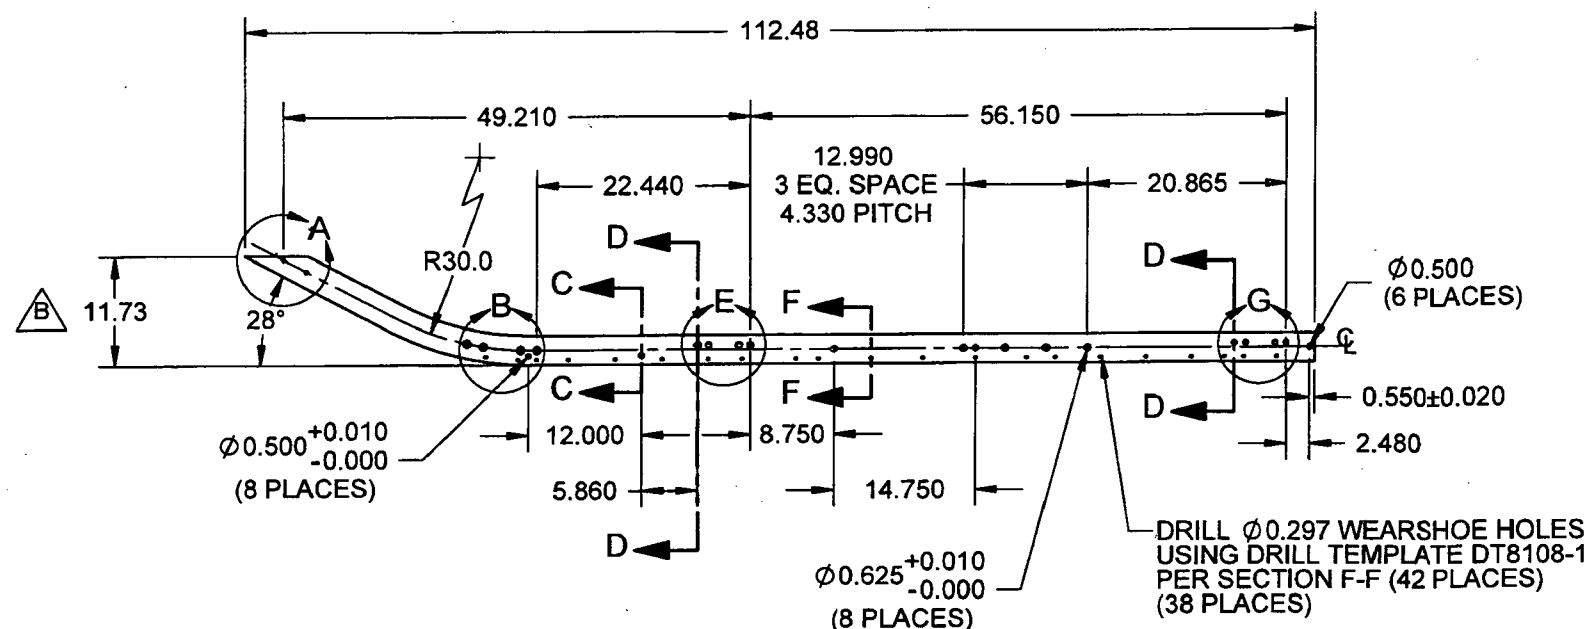


D2750-1 LH SKIDTUBE (SHOWN)
D2750-2 RH SKIDTUBE (OPPOSITE)

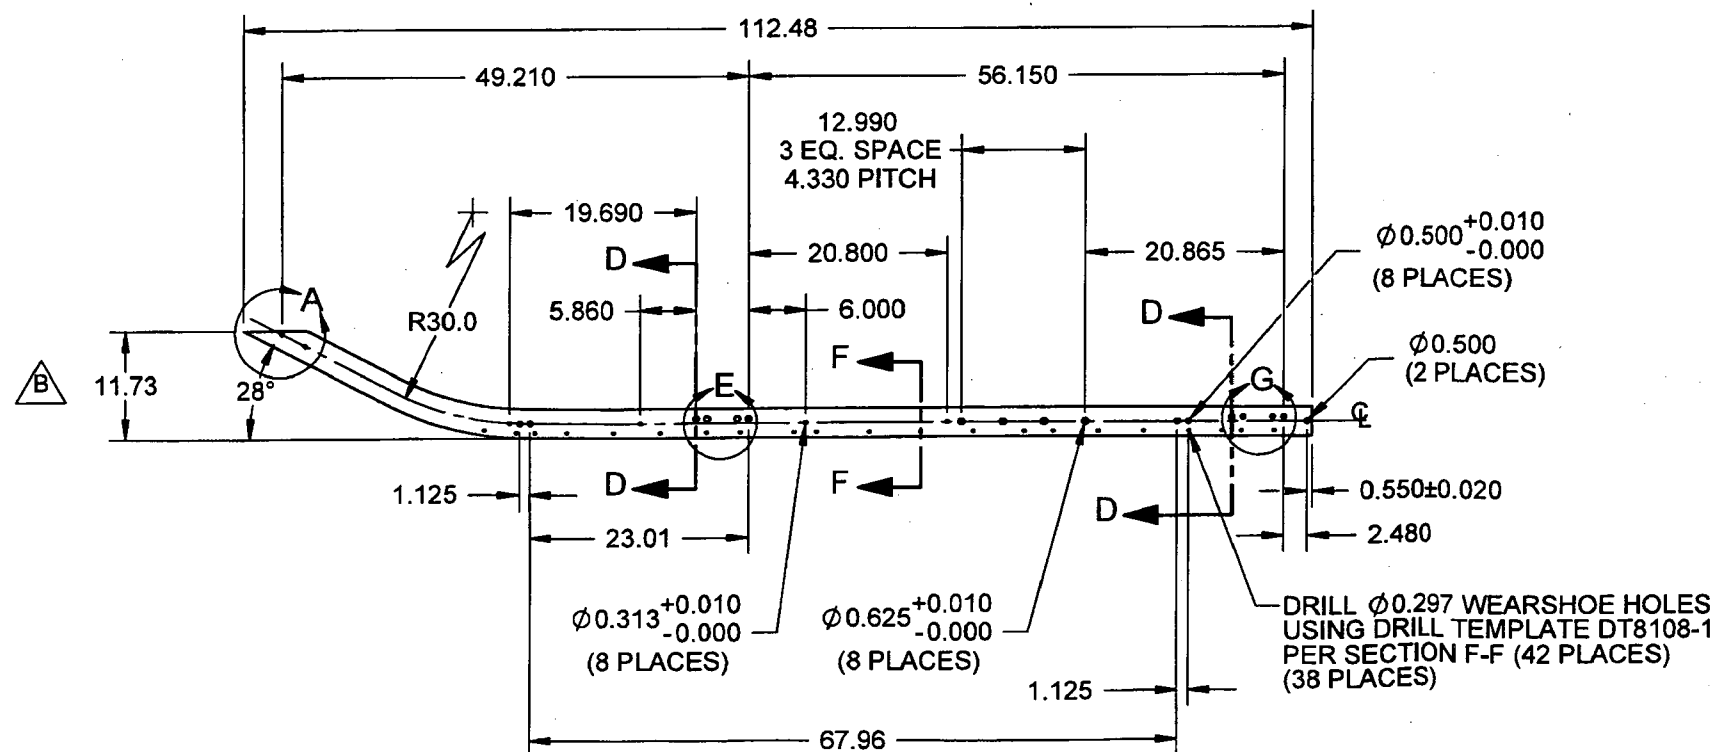


D2750-3 LH SKIDTUBE (SHOWN)
D2750-4 RH SKIDTUBE (OPPOSITE)

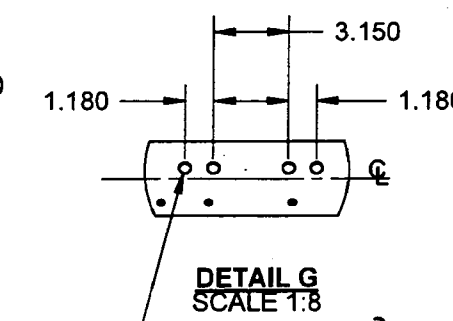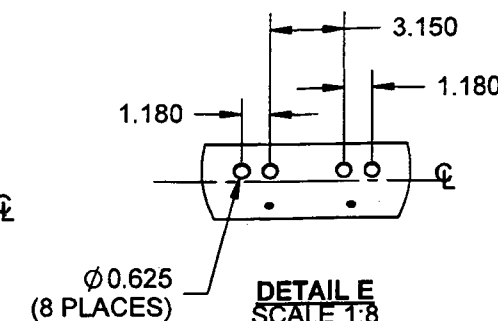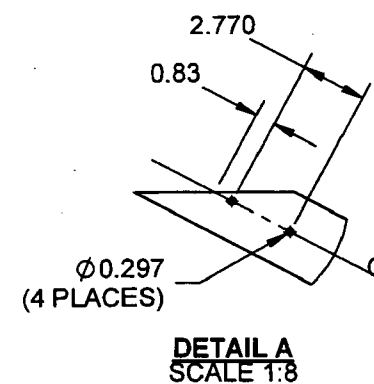


PH 07.02.22
UNDER REVIEW
UPDATE
PER
NSI 9413

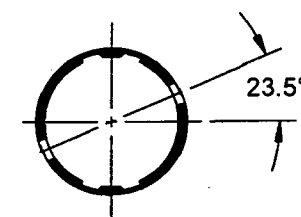

SECTION C-C
SCALE 1:4

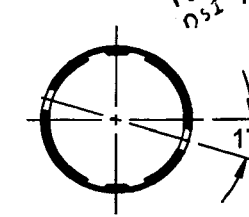


SECTION D-D
SCALE 1:4

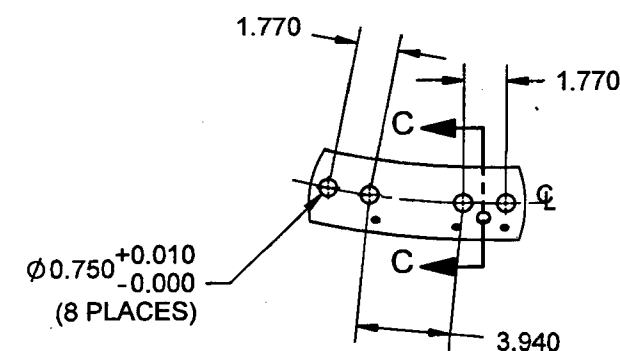

DETAIL B
SCALE 1:8
(ALL DIMENSIONS ARE STRAIGHT LINE DIMENSIONS)

RELEASED
07-08-02

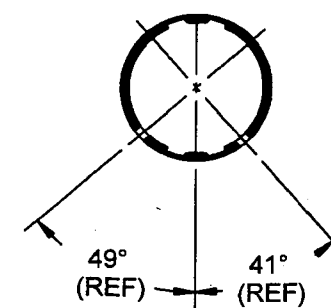

SECTION F-F
SCALE 1:4

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 40698

DESIGN PH	DRAWN BY CB	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED PH	APPROVED [Signature]	DRAWING NO. D2750	REV. E SHEET 3 OF 5
DATE 07.05.17		TITLE 350 SKIDTUBE ASSEMBLY	SCALE 1:20

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.